



Dart Aerospace Ltd.
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200
Fax 613 632-5246

4

D407-667-105TRN
Job Sheet 186550



Part No: D407-667-105TRN

Job Qty: 1 ea

Part Name: Crosstube Turning Detail



Part Weight: 0 lbs

Status: New

Priority: Medium

Job Created: 11/16/18

Job Tracking No:

Due Date: 12/10/18

Created By: Jesse White

Type: Stock

Description: SIOP

Note: DWG D407-667-145 REV.D IPP Rev:a 08.02.28 new issue EC IPP Rev B 08.04.02 Removed polish EC verified by: DD

Ship Via:

Bill of Materials

Job Routing

Op No	Operation	Qty	Start Date	Due Date	Standard		Workcenter/Supplier		Sign-off
					Setup Hrs	Run Hrs	Workcenter / Supplier	Lead Time	
90	Start up Operation	1 Ea		12/10/18	0.00	0.00	Start Up Crosstubes-2		MD 2019-01-23
100	Mori Seiki	1 pcs		12/10/18	2.21	1.25	Mori Seiki TL-40		MD 2019-01-24
110	QC	1 pcs		12/10/18	0.00	0.00	QC2-2		MD 2019-01-28
120	Mori Seiki	1 pcs		12/10/18	0.00	1.12	Mori Seiki TL-40		MD 2019-01-28
130	QC	1 pcs		12/10/18	0.00	0.00	QC2-2		DAS 67
140	QC	1 pcs		12/10/18	0.00	0.00	QC8		9-89
145	Crosstubes	1 pcs		12/10/18	0.00	0.36	Crosstubes-2		9-89
150	HandFXtube	1 pcs		12/10/18	0.00	0.40	Crosstubes-3		DAS 2/21
160	QC	1 pcs		12/10/18	0.00	0.00	QC7-3		267 19-03-11
170	Packaging	1 pcs		12/10/18	0.00	0.00	Packaging3-2		9-89 MAR 11 2019
180	QC21-SA	1 Ea		12/10/18	0.00	0.00	QC21		9-89

Part Op 100 - 1- Fill tube with sand & install plugs 407-105 on both ends as per Folio FA249 2- Turn both side of tube 3- Turn first Descriptions: taper section on both side as per folio FA249

120 - 1- Turn second taper on both side 4- Scribe part # and batch # using vibrating stylus on the cuff as per Dwg D407-667-145 5- Ultra sound the crosstube as per FAI. "wall thickness mesurment" at given location.

145 - GRIND ONLY TRANSITION LINES SMOOTH LONGITUDE WAY.

150 - 1- handfinish X-TUBE INSIDE AND OUT

170 - LOCATION : LG014

Job BOM

Part / Item	Component Name	Quantity	Operation	Container
D6010-115	Crosstube Material	1 Ea (1 ea)	90-Start up Operation	B123975

Job Allocations

Operation	Component Part	Required	Inventory	Allocated
90-Start up Operation	D6010-115	1	115	0

Part Specifications

Specifications could not be found.

④

DART AEROSPACE LTD	Work Order: 186350
Description: Crosstube Assembly	Part Number: D407-667-145
Inspection Dwg: D407-667-145 Rev: C	Page 1 of 2

FIRST ARTICLE INSPECTION CHECKLIST

	Inspection Sheet Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	2.240	+0.005/-0.000	2.245	✓		CNC-04	
	1.865	+0.005/-0.000	1.870	✓		CNC-08	
	1.878	+0.005/-0.000	1.883	✓		"	
	1.970	+0.005/-0.000	1.974	✓		"	
	2.030	+0.005/-0.000	2.034	✓		CNC-04	
	2.165	+0.005/-0.000	2.169	✓		"	
	0.125	+/-0.010	.133	✓		CNC-08	
	R0.063	+/-0.010	.063	✓		RG	
	R0.500	+/-0.010	.500	✓		"	
	R0.063	+/-0.010	.063	✓		"	
	4.438	+/-0.030	4.449	✓		CNC-08	
SIDE B	2.240	+0.005/-0.000	2.245	✓		CNC-04	
	1.865	+0.005/-0.000	1.870	✓		CNC-08	
	1.878	+0.005/-0.000	1.883	✓		"	
	1.970	+0.005/-0.000	1.974	✓		"	
	2.030	+0.005/-0.000	2.035	✓		CNC-04	
	2.165	+0.005/-0.000	2.169	✓		"	
	0.125	+/-0.010	.125	✓		CNC-08	
	R0.063	+/-0.010	.063	✓		RG	
	R0.500	+/-0.010	.500	✓		"	
	R0.063	+/-0.010	.063	✓		"	
	4.438	+/-0.030	4.447	✓		CNC-08	
	113.20	+/-0.020	113.190	✓		tape	

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____


Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor Approval Verification		
			QC / QA Coordinator Approval		
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : ☐					

(4)

DART AEROSPACE LTD	Work Order: 186550
Description: Crosstube Assembly	Part Number: D407-667-145
Inspection Dwg: D407-667-145 Rev: C	Page 2 of 2

WALL THICKNESS MEASUREMENT

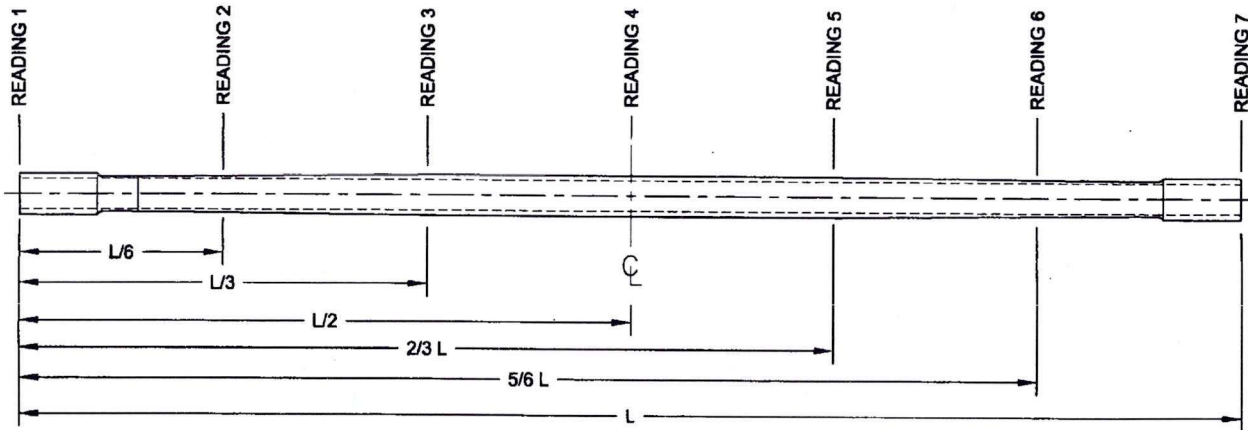

Location	WALL THICKNESS MEASUREMENT (IN)				Deviation Δw (max-min)	TOLERANCE
	w1	w2	w3	w4		
READING 1 L= 0"	328	324	323	306	.022	0.042"
READING 2 L= 18.867	174	171	180	179	.009	
READING 3 L= 37.734	272	273	273	267	.006	
READING 4 L= 56.700	316	319	330	322	.014	
READING 5 L= 75.467	269	269	270	270	.001	
READING 6 L= 94.333	186	174	166	176	.020	
READING 7 L= 113.20	320	330	320	314	.016	

Calibration Result

Actual Block Thickness: 100-500

SITSCAN 250 Measured Thickness: 100-500

Measured by: MD	Audited by: 9-8989	Preliminary Approval:
Date: 2019-01-28	Date: 19-02-04	Date:

Rev	Date	Change	Revised by	Approved
A	04.04.21	New Issue (P/O D407-667-105)	KJ/RF	
B	06.03.09	Dwg Rev updated	KJ/JLM	
C	09.06.11	Dwg Rev updated	KJ	
D	11.06.21	Tolerance revised for 4.438 dimension	KJ	
E	12.06.04	Wall thickness form added	KJ	

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : ☐					

Item	Qty -145	Part Number	Description
1	X	D407-667-145	CROSSTUBE ASSEMBLY (407 HIGH FWD)
2	1	D6010-115	CROSSTUBE
3	2	D2873-043	NUT PLATE
4	2	D2873-045	NUT PLATE
5	2	D2891-1	SUPPORT
6	4	D3595-063-395	RUBBER CUSHION
7	4	MS21920-20	CLAMP (OR MS21920-21)
8	14	MS20601AD4W10	RIVET (OR NAS9302B-4-10)
9	A/R	PROSEAL 890 B-2	SEALANT, AMS-S-8802 CLASS B-2
10	2	AN742D36	CLAMP
11	2	MS9165-05	ANGLE BRACKET
12	2	MS21042L3	NUT (OR MS21042-3)
13	2	MS27039-1-08	SCREW
14	4	NAS1149C0332R	WASHER (OR AN960C10L)

GENERAL NOTES:

- 1) MATERIAL: MANUFACTURED FROM D6010-115
FINISHED LENGTH = 113.20±0.020
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER "D407-667-145" AND BATCH NUMBER ON INSIDE OF CUFF USING VIBRATING STYLUS.
- 7) WEIGHT: 17.8 lbs
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) RUN CUTTER OFF PART WHERE INDICATED. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.
- 10) BEND PROGRESSIVELY WITH A MINIMUM OF 6 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- 11) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 12) TO INSTALL D2891-1 SUPPORT: ABRASE MATING SURFACE OF SUPPORT AND CROSSTUBE WITH 180-GRIT SANDPAPER AND REMOVE RESIDUE WITH MEK (OR EQUIVALENT). APPLY A 0.04" TO 0.07" THICK LAYER OF PROSEAL 890 CLASS B-2 (OR AMS-S-8802 CLASS B-2) SEALANT TO MATING SURFACE OF SUPPORT.
- 13) INSTALL MS21920-20 CLAMPS (OR -21) WITH D3595-063-395 RUBBER CUSHIONS TO SECURE THE D2891-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMP MECHANISMS ARE LOCATED ON CROSSTUBE SUPPORTS.
- 14) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS ARE SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS. MASK AREA UNDER CLAMP PRIOR TO PAINTING.
- 17) SEAL EDGES WHERE AN742D36 CLAMP MEETS WITH THE CROSSTUBE USING SIKAFLEX-241/-291 OR MIL-S-8802 CLASS B2 OR PROSEAL 890 SEALANT.
- 18) PERFORM RESISTANCE CHECK TO ENSURE MAX RESISTANCE IS 10 MEGOHMS.

RELEASED

2018 SEP 06
2018-797

D	REVISE SHEET 2 ASSEMBLY DETAIL HOLE PATTERN PER CAR18-221. UPDATE PARTS LIST AND GENERAL NOTES 12 & 15 TO INCORPORATE DEO C-1. ADD ITEMS 10-14 TO PARTS LIST, ADD GENERAL NOTES 16-18 AND ADD SHEET 5 TO INCORPORATE DEO C-2.	JMH	18.05.01
C	REVISE GENERAL NOTES/PART LIST (ZN D7-1); REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS. D3595-063-395 WAS D2858-400-694 (ZN D6-2 & A5-2); REMOVED REF. 7 ADD TOLERANCES (ZN C6-3, C4-3, D2-3); RELOCATED FLAG #6 (ZN A8-3) PER NCR 210; MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4.	RF	08.11.06
B	ADD HOLES AND NUT PLATES FOR COMPATABILITY WITH BHT/AA SKUDTUBES	PH	05.07.28
A	NEW ISSUE	CP	02.05.08
REV.	DESCRIPTION	BY	DATE
DESIGN	JP	DART AEROSPACE LTD	
DRAWN	JMH	HAWKESBURY, ONTARIO, CANADA	
CHECKED	ZF	DRAWING NO.	REV. D
MFG. APPR.	AFB	D407-667-145	SHEET 1 OF 5
APPROVED	NO	TITLE	SCALE
DE APPR.	JP	CROSSTUBE ASS'Y (407 HIGH FWD)	NTS
DATE	18.05.01	COPYRIGHT © 2002 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE


QA Closed: _____ Date: _____

Work Order update only ☐


Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td style="border: none;">Skid-tube ☐</td> <td style="border: none;">Cross tube ☐</td> <td style="border: none;">Water Jet ☐</td> <td style="border: none;">Engineering ☐</td> </tr> <tr> <td style="border: none;">Machining ☐</td> <td style="border: none;">Small Fab ☐</td> <td style="border: none;">Prod. Eng. Coord. ☐</td> <td style="border: none;">Quality ☐</td> </tr> <tr> <td style="border: none;">Thermoforming ☐</td> <td style="border: none;">Finishing ☐</td> <td style="border: none;">Rec/Store/Packaging ☐</td> <td style="border: none;">Other ☐</td> </tr> <tr> <td style="border: none;">Large Fab ☐</td> <td style="border: none;">Composite ☐</td> <td style="border: none;">Supplier ☐</td> <td></td> </tr> </table>				Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐																																																	
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																																																																		
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																																																																		
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																																																																		
Large Fab ☐	Composite ☐	Supplier ☐																																																																			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval																																																																	
Description Work Order Deviation			Disposition																																																																		
			Completed By																																																																		
			Lead hand / Supervisor Approval Verification																																																																		
			QC / QA Coordinator Approval																																																																		
Root Cause <table style="width:100%; border: none;"> <tr> <td style="border: none;">Environment ☐</td> <td style="border: none;">No Re-verification ☐</td> </tr> <tr> <td style="border: none;">Design ☐</td> <td style="border: none;">Operator ☐</td> </tr> <tr> <td style="border: none;">Doc/Data ☐</td> <td style="border: none;">Offset/Setup ☐</td> </tr> <tr> <td style="border: none;">Equip/Tooling ☐</td> <td style="border: none;">Supplier ☐</td> </tr> <tr> <td style="border: none;">Handling/Pre ☐</td> <td style="border: none;">Training ☐</td> </tr> <tr> <td style="border: none;">Material ☐</td> <td style="border: none;">Use for Testing ☐</td> </tr> <tr> <td style="border: none;">Internal Transport ☐</td> <td style="border: none;">Poor Information ☐</td> </tr> <tr> <td style="border: none;">Tribal Knowledge ☐</td> <td style="border: none;">Rushing ☐</td> </tr> <tr> <td style="border: none;">LOA ☐</td> <td style="border: none;">Product Improvement ☐</td> </tr> <tr> <td style="border: none;">Substation ☐</td> <td style="border: none;">Process Improvement ☐</td> </tr> <tr> <td style="border: none;">Past Expiry Date ☐</td> <td style="border: none;">Manufacturing Process ☐</td> </tr> <tr> <td style="border: none;">Misidentified ☐</td> <td style="border: none;">Past Due ☐</td> </tr> </table>		Environment ☐	No Re-verification ☐	Design ☐	Operator ☐	Doc/Data ☐	Offset/Setup ☐	Equip/Tooling ☐	Supplier ☐	Handling/Pre ☐	Training ☐	Material ☐	Use for Testing ☐	Internal Transport ☐	Poor Information ☐	Tribal Knowledge ☐	Rushing ☐	LOA ☐	Product Improvement ☐	Substation ☐	Process Improvement ☐	Past Expiry Date ☐	Manufacturing Process ☐	Misidentified ☐	Past Due ☐	FAULT CATEGORY <table style="width:100%; border: none;"> <tr> <td style="border: none;">Pressure/Forced ☐</td> <td style="border: none;">Temperature/Cure ☐</td> <td style="border: none;">Power Loss/Surge ☐</td> <td style="border: none;">Positioned Wrong ☐</td> </tr> <tr> <td style="border: none;">Bending ☐</td> <td style="border: none;">Set-up ☐</td> <td style="border: none;">Folio/Program ☐</td> <td style="border: none;">Outside Dimensions ☐</td> </tr> <tr> <td style="border: none;">Centre Not Concentric ☐</td> <td style="border: none;">BOM/Route ☐</td> <td style="border: none;">Grain ☐</td> <td style="border: none;">Over/Under tolerance ☐</td> </tr> <tr> <td style="border: none;">Cracks ☐</td> <td style="border: none;">Broken/Damage/Defect ☐</td> <td style="border: none;">Weld ☐</td> <td style="border: none;">Part Incorrect ☐</td> </tr> <tr> <td style="border: none;">Crimp/Kink/Ripple/Wave ☐</td> <td style="border: none;">Inspection Incomplete/Unqualified ☐</td> <td style="border: none;">Wrong Stock Pulled ☐</td> <td style="border: none;">Part Lost/Missing ☐</td> </tr> <tr> <td style="border: none;">Cuffs ☐</td> <td style="border: none;">Contamination ☐</td> <td style="border: none;">Out of Sequence ☐</td> <td style="border: none;">Part Moved ☐</td> </tr> <tr> <td style="border: none;">Crushing ☐</td> <td style="border: none;">Countersink ☐</td> <td style="border: none;">Off-set ☐</td> <td style="border: none;">Drawing ☐</td> </tr> <tr> <td style="border: none;">Heat Treat ☐</td> <td style="border: none;">Cut Too Short ☐</td> <td style="border: none;">Mislabeled ☐</td> <td style="border: none;">Finish ☐</td> </tr> <tr> <td style="border: none;">Wave/Twist in Tube ☐</td> <td style="border: none;">Instructions Incomplete/Unclear ☐</td> <td style="border: none;">Fit/Function ☐</td> <td style="border: none;">Misread ☐</td> </tr> <tr> <td style="border: none;">Marks/Chatter ☐</td> <td style="border: none;">Drill Holes ☐</td> <td style="border: none;">Misaligned/off center ☐</td> <td style="border: none;">Turning Sequence ☐</td> </tr> </table>				Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐
Environment ☐	No Re-verification ☐																																																																				
Design ☐	Operator ☐																																																																				
Doc/Data ☐	Offset/Setup ☐																																																																				
Equip/Tooling ☐	Supplier ☐																																																																				
Handling/Pre ☐	Training ☐																																																																				
Material ☐	Use for Testing ☐																																																																				
Internal Transport ☐	Poor Information ☐																																																																				
Tribal Knowledge ☐	Rushing ☐																																																																				
LOA ☐	Product Improvement ☐																																																																				
Substation ☐	Process Improvement ☐																																																																				
Past Expiry Date ☐	Manufacturing Process ☐																																																																				
Misidentified ☐	Past Due ☐																																																																				
Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐																																																																		
Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐																																																																		
Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐																																																																		
Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐																																																																		
Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐																																																																		
Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐																																																																		
Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐																																																																		
Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐																																																																		
Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐																																																																		
Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐																																																																		
OTHER :																																																																					

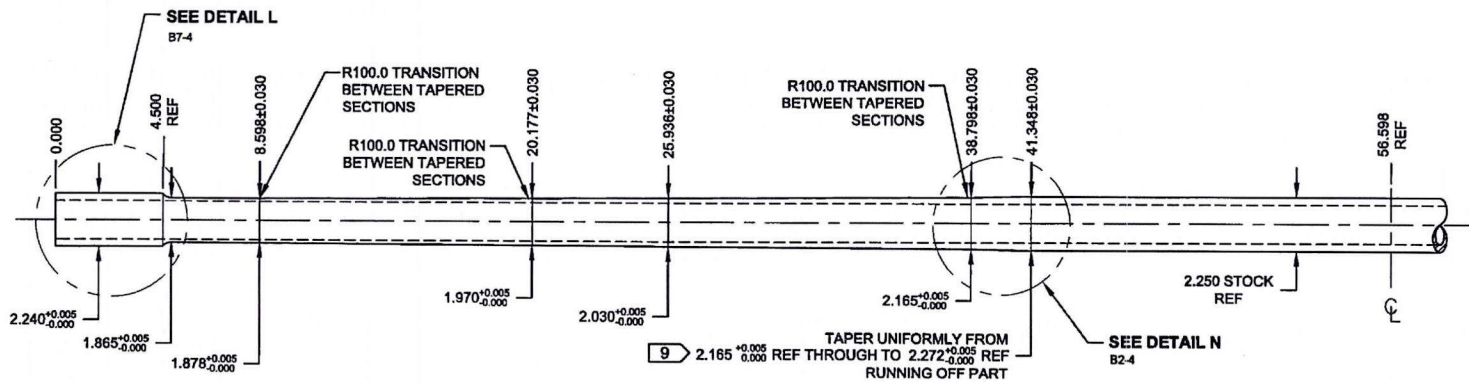


TURNING DETAIL

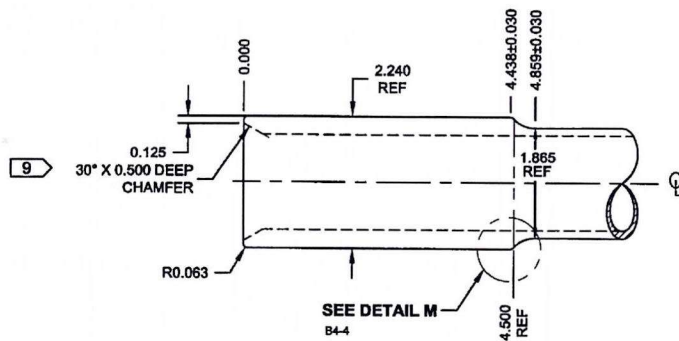

DETAIL L:
D7-4 CROSSTUBE CUFF
NOT TO SCALE

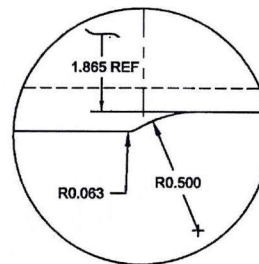

DETAIL M:
B8-4 CUFF TRANSITION
NOT TO SCALE

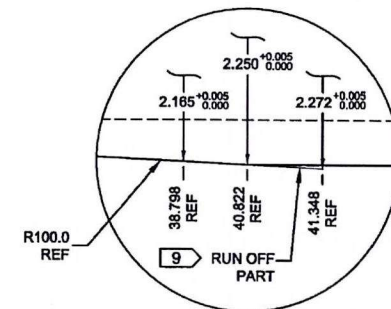

DETAIL N:
C3-4 TAPER RUN-OFF
NOT TO SCALE

RELEASED

2018 SEP 06

DESIGN	90	DART AEROSPACE LTD	
DRAWN	JMH	HAWKESBURY, ONTARIO, CANADA	
CHECKED	ZF	DRAWING NO.	REV. D
MFG. APPR.	AFS	D407-667-145	SHEET 4 OF 5
APPROVED	ND	TITLE	SCALE
DE APPR.	90	CROSSTUBE ASS'Y (407 HIGH FWD)	NTS
DATE	18.05.01	COPYRIGHT © 2002 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td style="width:15%;">Skid-tube</td><td style="width:15%;">Cross tube</td><td style="width:15%;">Water Jet</td><td style="width:15%;">Engineering</td></tr> <tr> <td>Machining</td><td>Small Fab</td><td>Prod. Eng. Coord.</td><td>Quality</td></tr> <tr> <td>Thermoforming</td><td>Finishing</td><td>Rec/Store/Packaging</td><td>Other</td></tr> <tr> <td>Large Fab</td><td>Composite</td><td>Supplier</td><td></td></tr> </table>						Skid-tube	Cross tube	Water Jet	Engineering	Machining	Small Fab	Prod. Eng. Coord.	Quality	Thermoforming	Finishing	Rec/Store/Packaging	Other	Large Fab	Composite	Supplier																																																			
Skid-tube	Cross tube	Water Jet	Engineering																																																																								
Machining	Small Fab	Prod. Eng. Coord.	Quality																																																																								
Thermoforming	Finishing	Rec/Store/Packaging	Other																																																																								
Large Fab	Composite	Supplier																																																																									
Date :		Step #:		QTY Effective :		MRB (QSI042) Approval																																																																					
Description Work Order Deviation				Disposition																																																																							
								Completed By																																																																			
								Lead hand / Supervisor Approval Verification																																																																			
								QC / QA Coordinator Approval																																																																			
Root Cause				FAULT CATEGORY																																																																							
<table style="width:100%; border: none;"> <tr> <td style="width:15%;">Environment</td><td style="width:15%;">No Re-verification</td></tr> <tr> <td>Design</td><td>Operator</td></tr> <tr> <td>Doc/Data</td><td>Offset/Setup</td></tr> <tr> <td>Equip/Tooling</td><td>Supplier</td></tr> <tr> <td>Handling/Pre</td><td>Training</td></tr> <tr> <td>Material</td><td>Use for Testing</td></tr> <tr> <td>Internal Transport</td><td>Poor Information</td></tr> <tr> <td>Tribal Knowledge</td><td>Rushing</td></tr> <tr> <td>LOA</td><td>Product Improvement</td></tr> <tr> <td>Substation</td><td>Process Improvement</td></tr> <tr> <td>Past Expiry Date</td><td>Manufacturing Process</td></tr> <tr> <td>Misidentified</td><td>Past Due</td></tr> </table>				Environment	No Re-verification	Design	Operator	Doc/Data	Offset/Setup	Equip/Tooling	Supplier	Handling/Pre	Training	Material	Use for Testing	Internal Transport	Poor Information	Tribal Knowledge	Rushing	LOA	Product Improvement	Substation	Process Improvement	Past Expiry Date	Manufacturing Process	Misidentified	Past Due	<table style="width:100%; border: none;"> <tr> <td style="width:15%;">Pressure/Forced</td><td style="width:15%;">Temperature/Cure</td></tr> <tr> <td>Bending</td><td>Set-up</td></tr> <tr> <td>Centre Not Concentric</td><td>BOM/Route</td></tr> <tr> <td>Cracks</td><td>Broken/Damage/Defect</td></tr> <tr> <td>Crimp/Kink/Ripple/Wave</td><td>Inspection Incomplete/Unqualified</td></tr> <tr> <td>Cuffs</td><td>Contamination</td></tr> <tr> <td>Crushing</td><td>Countersink</td></tr> <tr> <td>Heat Treat</td><td>Cut Too Short</td></tr> <tr> <td>Wave/Twist in Tube</td><td>Instructions Incomplete/Unclear</td></tr> <tr> <td>Marks/Chatter</td><td>Drill Holes</td></tr> </table>				Pressure/Forced	Temperature/Cure	Bending	Set-up	Centre Not Concentric	BOM/Route	Cracks	Broken/Damage/Defect	Crimp/Kink/Ripple/Wave	Inspection Incomplete/Unqualified	Cuffs	Contamination	Crushing	Countersink	Heat Treat	Cut Too Short	Wave/Twist in Tube	Instructions Incomplete/Unclear	Marks/Chatter	Drill Holes	<table style="width:100%; border: none;"> <tr> <td style="width:15%;">Power Loss/Surge</td><td style="width:15%;">Positioned Wrong</td></tr> <tr> <td>Folio/Program</td><td>Outside Dimensions</td></tr> <tr> <td>Grain</td><td>Over/Under tolerance</td></tr> <tr> <td>Weld</td><td>Part Incorrect</td></tr> <tr> <td>Wrong Stock Pulled</td><td>Part Lost/Missing</td></tr> <tr> <td>Out of Sequence</td><td>Part Moved</td></tr> <tr> <td>Off-set</td><td>Drawing</td></tr> <tr> <td>Mislabeled</td><td>Finish</td></tr> <tr> <td>Fit/Function</td><td>Misread</td></tr> <tr> <td>Misaligned/off center</td><td>Turning Sequence</td></tr> </table>				Power Loss/Surge	Positioned Wrong	Folio/Program	Outside Dimensions	Grain	Over/Under tolerance	Weld	Part Incorrect	Wrong Stock Pulled	Part Lost/Missing	Out of Sequence	Part Moved	Off-set	Drawing	Mislabeled	Finish	Fit/Function	Misread	Misaligned/off center	Turning Sequence
Environment	No Re-verification																																																																										
Design	Operator																																																																										
Doc/Data	Offset/Setup																																																																										
Equip/Tooling	Supplier																																																																										
Handling/Pre	Training																																																																										
Material	Use for Testing																																																																										
Internal Transport	Poor Information																																																																										
Tribal Knowledge	Rushing																																																																										
LOA	Product Improvement																																																																										
Substation	Process Improvement																																																																										
Past Expiry Date	Manufacturing Process																																																																										
Misidentified	Past Due																																																																										
Pressure/Forced	Temperature/Cure																																																																										
Bending	Set-up																																																																										
Centre Not Concentric	BOM/Route																																																																										
Cracks	Broken/Damage/Defect																																																																										
Crimp/Kink/Ripple/Wave	Inspection Incomplete/Unqualified																																																																										
Cuffs	Contamination																																																																										
Crushing	Countersink																																																																										
Heat Treat	Cut Too Short																																																																										
Wave/Twist in Tube	Instructions Incomplete/Unclear																																																																										
Marks/Chatter	Drill Holes																																																																										
Power Loss/Surge	Positioned Wrong																																																																										
Folio/Program	Outside Dimensions																																																																										
Grain	Over/Under tolerance																																																																										
Weld	Part Incorrect																																																																										
Wrong Stock Pulled	Part Lost/Missing																																																																										
Out of Sequence	Part Moved																																																																										
Off-set	Drawing																																																																										
Mislabeled	Finish																																																																										
Fit/Function	Misread																																																																										
Misaligned/off center	Turning Sequence																																																																										
OTHER :																																																																											